


**Repair
Procedure**

1. Inspect the location where the Bank 1 cylinder head, engine block, and timing cover meet for signs of an oil leak.
2. Use an oil dye to confirm the source of the oil leak.

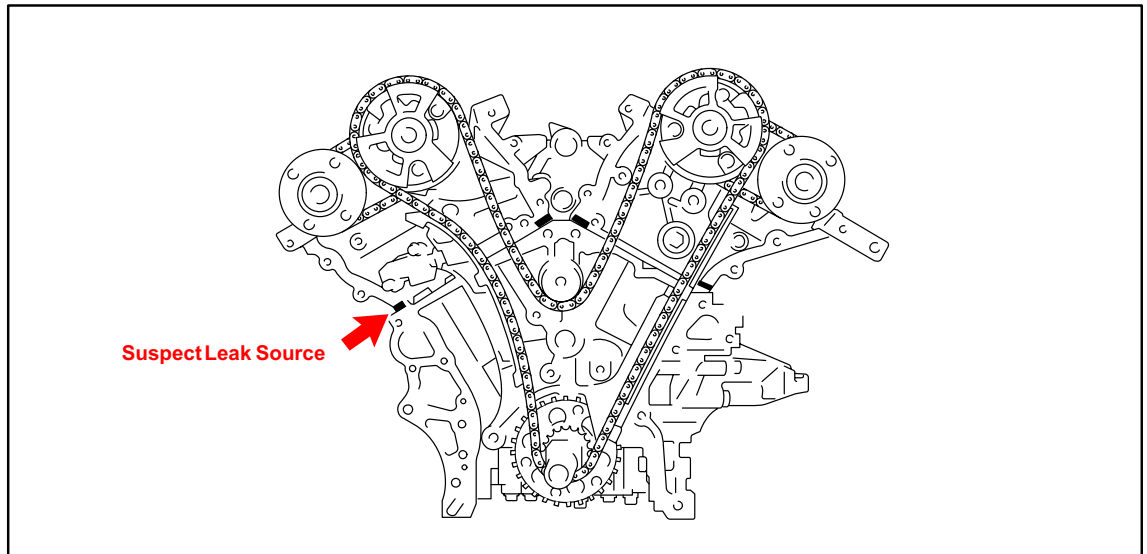

3. Remove and reseal the timing cover if confirmed leaking.
Refer to the Technical Information System (TIS), 2007 model year ES 350 Repair Manual:
 - *Engine/Hybrid System – Lubrication – “2GR-FE Lubrication: Oil Pump: Removal”*
 - *Engine/Hybrid System – Lubrication – “2GR-FE Lubrication: Oil Pump: Installation”*
4. Confirm that the repair corrected the condition.