


B-Pillar Lower Garnish Damaged

Service Category Vehicle Interior

Section Interior Panels/Trim

Market USA

Lexus Supports
ASE Certification 

Applicability

| YEAR(S) | MODEL(S) | ADDITIONAL INFORMATION |
|-------------|----------|------------------------|
| 2006 | GS300 | |
| 2007 – 2008 | GS350 | |
| 2006 – 2007 | GS430 | |
| 2007 – 2008 | GS450H | |
| 2008 | GS460 | |

Introduction

Some 2006-2008 model year GS vehicles may exhibit gouging and scratching on the lower center “B” pillar garnish moldings. A countermeasured garnish molding has been developed to remedy this condition. This bulletin provides updated parts information and recommended repair procedures for replacement of both the RH and LH lower “B” pillar garnish moldings.

Production Change Information

This TSB applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

| MODEL | DRIVETRAIN | PLANT | PRODUCTION CHANGE EFFECTIVE VIN |
|--------|------------|--------|---------------------------------|
| GS350 | 2WD | Tahara | JTHBE96S#80036681 |
| | AWD | | JTHCE96S#80017685 |
| GS460 | 2WD | | JTHBL96S#85002321 |
| GS450h | | | JTHBC96S#85015065 |

Parts Information

| PREVIOUS PART NUMBER | CURRENT PART NUMBER | PART NAME | QTY |
|----------------------|---------------------|---------------------------------|-----|
| 62413-30211-A0 | 62413-30250-A0 | Garnish Center Pillar, Lower RH | 1 |
| 62413-30211-B0 | 62413-30250-B0 | | 1 |
| 62413-30211-C0 | 62413-30250-C0 | | 1 |

B-Pillar Lower Garnish Damaged

Parts Information (Continued)

| PREVIOUS PART NUMBER | CURRENT PART NUMBER | PART NAME | QTY |
|----------------------|---------------------|---------------------------------|-----|
| 62414-30141-A0 | 62414-30180-A0 | Garnish Center Pillar, Lower LH | 1 |
| 62414-30141-B0 | 62414-30180-B0 | | 1 |
| 62414-30141-C0 | 62414-30180-C0 | | 1 |

Warranty Information

| OP CODE | DESCRIPTION | TIME | OFF | T1 | T2 |
|---------|--|------|----------------|----|----|
| BO7008 | Replace Center Pillar Garnish (both sides) | 0.4 | 6241#-50080-## | 97 | 19 |

APPLICABLE WARRANTY


- This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to correction of a problem based upon a customer's specific complaint.

Repair Procedure

1. Remove the front door scuff plate LH.

Using a molding remover, detach the 5 claws and remove the scuff plate.

Figure 1.

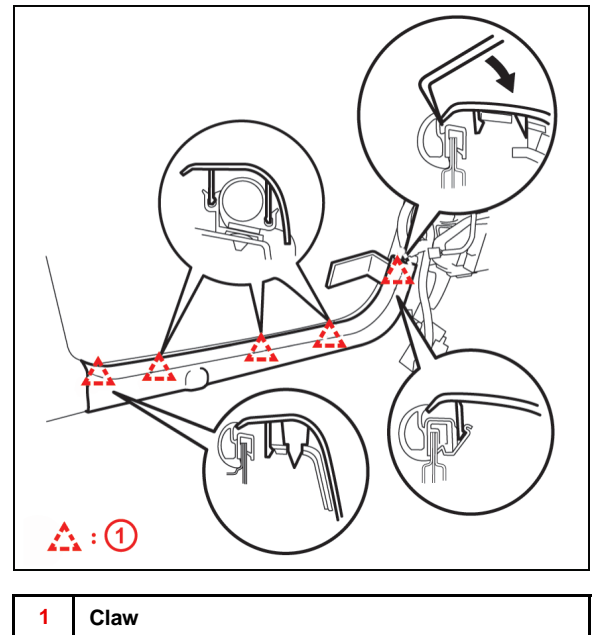

B-Pillar Lower Garnish Damaged

Repair Procedure (Continued)

2. Remove the front door scuff plate RH.

HINT

Use the same procedures described for the LH side.

3. Remove the front door opening trim cover LH.

Using a molding remover, detach the 3 claws and remove the trim cover.

4. Remove the front door opening trim cover RH


HINT

Use the same procedures described for the LH side.

5. Remove the rear door scuff plate LH

Detach the 5 claws and remove the scuff plate.

Figure 2.

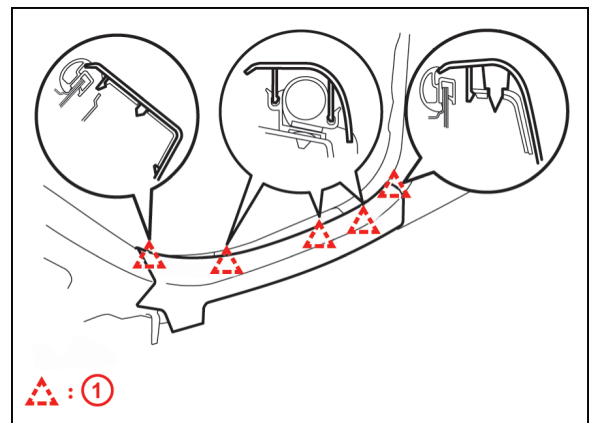

| | |
|---|------|
| 1 | Claw |
|---|------|

6. Remove the rear door scuff plate RH

HINT

Use the same procedures described for the LH side.


B-Pillar Lower Garnish Damaged

Repair Procedure (Continued)

7. Remove the center pillar garnish Lower LH

Detach the 2 claws and 5 clips, and remove the garnish.

Figure 3.

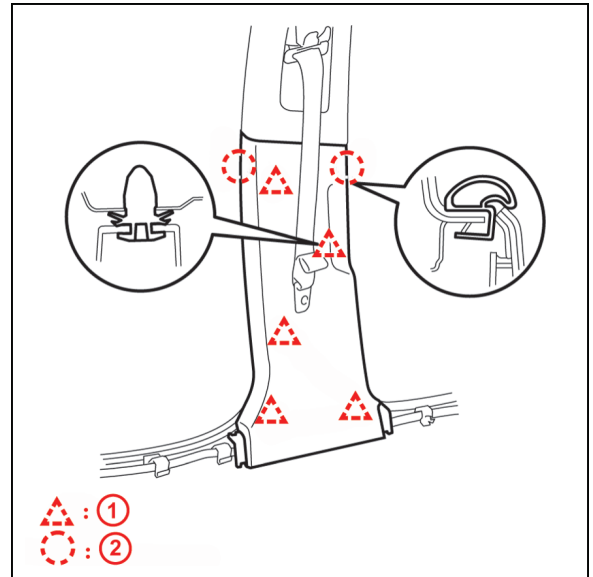

| | |
|---|------|
| 1 | Clip |
| 2 | Claw |

8. Remove the center pillar garnish lower RH

HINT

Use the same procedures described for the LH side.

9. Reinstall in reverse order.