



L-SB-0167-08

December 11, 2008

SRS Light "ON" - DTC B1861

Service Category Vehicle Interior

Lexus Supports ASE Certification 

Section Supplemental Restraint Systems

Market USA

Applicability

| YEAR(S) | MODEL(S) | ADDITIONAL INFORMATION |
|-------------|--------------|------------------------|
| 2006 - 2008 | IS250, IS350 | |

Introduction

Some 2006-2008 MY IS250/350 vehicles may exhibit a SRS Light "On" condition with DTG B1861. Use the following information to address this condition.

Warranty Information

| OP CODE | DESCRIPTION | TIME | OFF | T1 | T2 |
|---------|-----------------------------------|------|-------------|----|----|
| EL8054 | R&R Instrument Panel Wire Harness | 4.5 | 82141-53### | 8B | 71 |

APPLICABLE WARRANTY

- This repair is covered under the Lexus Restraint System Warranty. This warranty is in effect for 72 months or 70,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to correction of a problem based upon a customer's specific complaint.

Parts Information

| PREVIOUS PART NUMBER | CURRENT PART NUMBER | PART NAME | QTY |
|----------------------|---------------------|------------------------|-----|
| 82141-53### | Same | Wire, Instrument Panel | 1 |

NOTE

A80F-4K

Please see the Parts Identification Method section of this TSIB to determine the correct wire harness part number.