


Lower Seat Cushion Uncomfortable

Service Category Vehicle Interior

Section Seat

Market USA

Lexus Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2007 – 2008	LS460, LS600H	Plant Code(s): 5 WMI(s): JTH
2009	LS460, LS600H	

Introduction

Some customers may complain that the rear portion of the driver or passenger seat cushion is uncomfortable or seems too firm. A revised seat cushion has been developed to improve this condition.

Production Change Information

This TSIB applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
LS460 / 460L	1UR FSE	JTHBL46F#95084466
		JTHGL46F#95033398
		JTHCL46F#95000116
		JTHDL46F#95000114
LS600h	2UR FSE	JTHDU46F#95009698

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
BD8048	Front Seat Cushion/Cover Replacement. (One Side)	1.1	71512-50170	99	57
Combo A	Opposite Side	1.1			

APPLICABLE WARRANTY

- This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to correction of a problem based upon a customer's specific complaint.

Lower Seat Cushion Uncomfortable

Parts Information

LH Front Seat

PREVIOUS PART NUMBER	TRIM CODE	CURRENT PART NUMBER	TRIM CODE	PART NAME	QTY
71512-50170 71512-50171	N/A	71512-50171	N/A	Pad, Front Seat Cushion LH	1
71072-50550 71072-50551	A4/A5 B2/C2	71072-50551	A4/A5 B2/C2	Cover, Front Seat Cushion LH	1
71072-50580 71072-50581	A4/A5 B2/C2	71072-50581	A4/A5 B2/C2	Cover, Front Seat Cushion LH	1
71072-50610 71072-50611	A2/A3 B1/C1	71072-50611	A2/A3 B1/C1	Cover, Front Seat Cushion LH	1
90468-16019	-	Same	-	Hog Ring	16

RH Front Seat

PREVIOUS PART NUMBER	TRIM CODE	CURRENT PART NUMBER	TRIM CODE	PART NAME	QTY
71001-50U50	A0/A1 B0/C0	Same	A0/A1 B0/C0	Cushion Assy, Front Seat RH	1
71001-50U60	A0/A1 B0/C0	Same	A0/A1 B0/C0	Cushion Assy, Front Seat RH	1
71001-50U70	A0/A1 B0/C0	Same	A0/A1 B0/C0	Cushion Assy, Front Seat RH	1

NOTE

Some 2007 MY vehicles will need a cushion cover along with the replacement pad. Please refer to the VIN information in the table below for which vehicles need to receive a cover and cushion.

Parts Information

MODEL	REPLACEMENT PART	PRODUCTION CHANGE EFFECTIVE VIN
LS 460 / 460L	Cushion & Cover	Before VIN: JTHBL46F375037249 JTHGL46F675015364
	Cushion Only	After VIN: JTHBL46F375037249 JTHGL46F675015364

Lower Seat Cushion Uncomfortable

Repair Procedure

1. Remove seat and replace lower cushion pad assembly.

Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:

- [2007](#) / [2008](#) / [2009](#) LS 460:
Vehicle Interior – Seat – Front Seat Assembly – “Seat: Front Seat Assembly: Removal”
- [2007](#) / [2008](#) / [2009](#) LS 460:
Vehicle Interior – Seat – Front Seat Assembly – “Seat: Front Seat Assembly: Disassembly”
- [2007](#) / [2008](#) / [2009](#) LS 460:
Vehicle Interior – Seat – Front Seat Assembly – “Seat: Front Seat Assembly: Reassembly”
- [2008](#) / [2009](#) LS 600H:
Vehicle Interior – Seat – Front Seat Assembly – “Seat: Front Seat Assembly: Disassembly”
- [2008](#) / [2009](#) LS 600H:
Vehicle Interior – Seat – Front Seat Assembly – “Seat: Front Seat Assembly: Reassembly”

2. Initialize passenger front seat.

NOTE

When performing repair on Passenger Front Seat, be sure to initialize Occupant Classification ECU once repair is complete.

- [2007](#) / [2008](#) / [2009](#) LS 460:
Vehicle Interior – Supplemental Restraint System – “Occupant Classification System: Initialization”
- [2008](#) / [2009](#) LS 600H:
Vehicle Interior – Supplemental Restraint System – “Occupant Classification System: Initialization”