



**Technical Service
Information Bulletin**

October 13, 2006

Title:
A/C LIGHT BLINKING

Models:
'07 RX 350

T S I B

AC004-06

HEATING & AIR CONDITIONING

Introduction Some customers may experience the A/C light blinking and/or a “Check A/C System” error message on the multi-display. Production changes to the A/C amplifier have been made to remedy this concern.

- Applicable Vehicles**
- **2007** model year **RX 350** vehicles produced **BEFORE** the Production Change Effective VINs shown below.

**Production
Change
Information**

MODEL	PLANT	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
RX 350	TMK	2WD	JTJGK31U#70004858
		4WD	JTJHK31U#72013500
	TMMC	2WD	2T2GK31U#7C011001
		4WD	2T2HK31U#7C018238

**Parts
Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
88650-0E020	88650-0E021	Amplifier Assembly, Air Conditioner	1

**Warranty
Information**

OP CODE	DESCRIPTION	TIME	OPF	T1	T2
AC0007	R & R A/C Amplifier	0.4	88650-0E020	99	99

Applicable Warranty*:

This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



**Repair
Procedure**

1. Disconnect the negative (-) battery terminal.
2. Remove the RH front door scuff plate.
3. Remove the RH cowl side trim sub-assembly.
4. Remove the instrument panel under cover sub-assembly.
5. Remove the glove compartment door assembly.
6. Remove the ECM.
7. Remove the air conditioner amplifier assembly.
 - A. Disconnect the connectors, including the suspension control ECU connectors.
 - B. Remove the 2 nuts retaining the air conditioner amplifier assembly/suspension control ECU bracket.
8. Remove the suspension control ECU from the bracket (w/ air suspension).
9. Reassemble in reverse order of disassembly.
10. Perform all necessary re-initialization procedures.

Refer to the following TSIBs:

- TSIB No. PD006-06, "Initialization of Power Back Door During PDS"
- TSIB No. PD007-06, "Initialization of Sliding Roof During PDS"
- TSIB No. PD008-06, "Initialization of Power Window During PDS"

