


Last Modified: 7-13-2007		1.7 G
Service Category: Vehicle Interior	Section: Supplemental Restraint Systems	
Model Year: 2008	Model: ES350	Doc ID: RM000000V2X00FX
Title: SUPPLEMENTAL RESTRAINT SYSTEM: FRONT PASSENGER SIDE KNEE AIRBAG ASSEMBLY: ON-VEHICLE INSPECTION (2008 ES350)		

ON-VEHICLE INSPECTION

1. INSPECT FRONT PASSENGER SIDE KNEE AIRBAG ASSEMBLY (VEHICLE NOT INVOLVED IN COLLISION)

(a) Perform a diagnostic system check

INFO

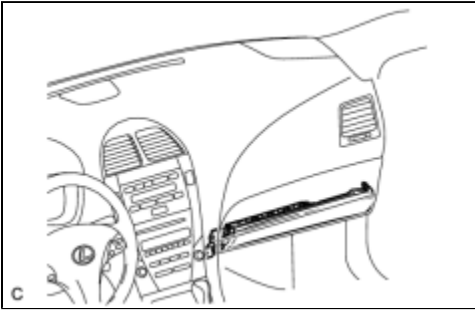


(b) With the front passenger side knee airbag assembly installed on the vehicle, perform a visual check. If there are any defects as mentioned below, replace the front passenger side knee airbag assembly with a new one:

Cuts, minute cracks or marked discoloration on the front passenger side knee airbag assembly.

2. INSPECT FRONT PASSENGER SIDE KNEE AIRBAG ASSEMBLY (VEHICLE INVOLVED IN COLLISION AND AIRBAG HAS NOT DEPLOYED)

(a) Perform a diagnostic system check

INFO

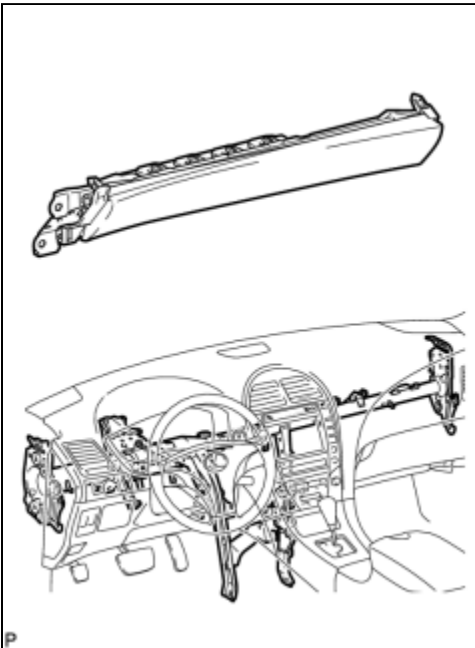

(b) With the front passenger side knee airbag assembly removed from the vehicle, perform a visual check. If there are any defects as mentioned below, replace the front passenger side knee airbag assembly with a new one:

- Cuts, minute cracks or marked discoloration on the front passenger side knee airbag assembly.
- Cracks or other damage to the connector.
- Deformation or cracks on the instrument panel reinforcement.

CAUTION:

Be sure to follow the correct removal and installation procedure.