


INSPECTION

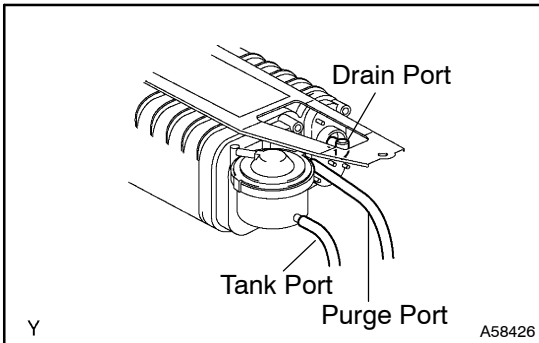


1. INSPECT CHARCOAL CANISTER ASSY

- (a) Inspect the charcoal canister operation.
 - (1) Check the charcoal canister operation according to the table below.

Criterion:

Checking way	Criterion
Close port then apply vacuum to port	No leak
Close port then apply vacuum to port	Air flows from port
Close port then blow air into port	Air flows from port
Blow air into port	Air flows from both port

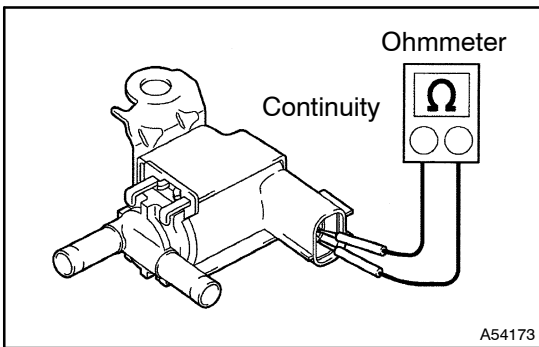

2. INSPECT VACUUM SWITCHING VALVE ASSY

- (a) Inspect the VSV for open circuit.
 - (1) Using an ohmmeter, check that there is continuity between the terminals.

Resistance: 30 – 34 Ω at 20°C (68°F)

If there is no continuity, replace the VSV.