


INSPECTION

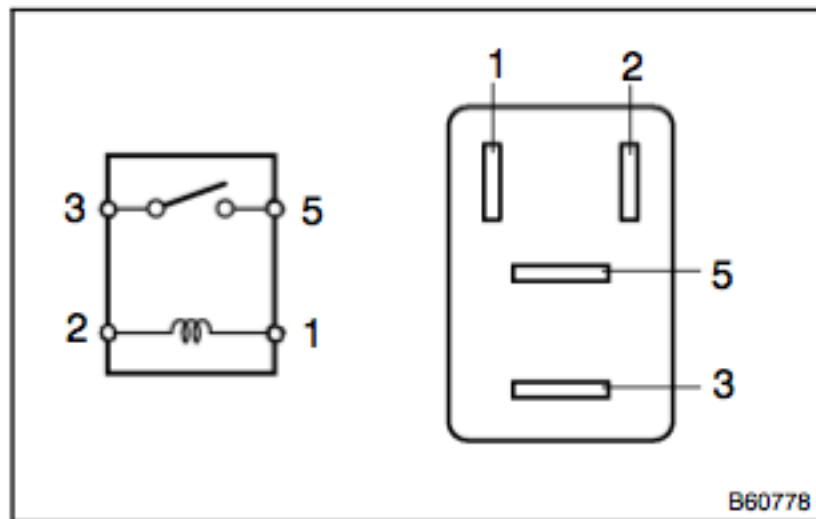

1. INSPECT RELAY (Marking: ACC)

(a) Measure the resistance of the ACC relay.

Standard :

Tester Condition	Specified Condition
3 - 5	10 k Ω or higher
3 - 5	Below 1 Ω (when battery voltage is applied to terminals 1 and 2)

If the result is not as specified, replace the relay.