


F-Sport Front Sway Bar Thump Noise

Service Category Suspension

Section Front Suspension

Market USA

Lexus Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2006	GS300	Drive Type(s): 2WD VDS(s): BH96S
2007 – 2010	GS350	Drive Type(s): 2WD VDS(s): BE96S

Introduction

Some 2006 – 2010 model year GS vehicles equipped with F-Sport sway bars may exhibit a thump noise from the front suspension when driving. New front bushings are available to improve this condition. Follow the Accessory Installation procedure in TIS to replace the front bushings.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
430211	R & R Sway Bar Bushing	0.4	PTR02-30090	91	50
Combo A	Opposite Side	0.1			

APPLICABLE WARRANTY

- F-Sport Performance parts installed as original equipment are covered under the Lexus Accessory Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- F-Sport Performance parts installed by a Lexus dealer are warranted for 12 months, regardless of mileage, from the date of installation on the vehicle, or the remainder of the applicable New Vehicle Limited Warranty, whichever provides the greater coverage.
- F-Sport Performance parts purchased over-the-counter are covered for 12 months from the date of purchase.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

F-Sport Front Sway Bar Thump Noise

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
N/A	PTR02-30100	Bushings, Sway Bar, Front	1

NOTE

The revised bushings are identified with a “ZD” marking, and the original bushings are identified with an “AB” marking.


Repair Procedure

1. Replace the sway bar bushings.

Please reference the Accessory Installation procedure found on the Technical Information System (TIS):

[2006 GS300 2007 - 2010 GS350 2WD F Sport Sway Bar Set PTR02-30090 Rev. A](#)

Figure 1.

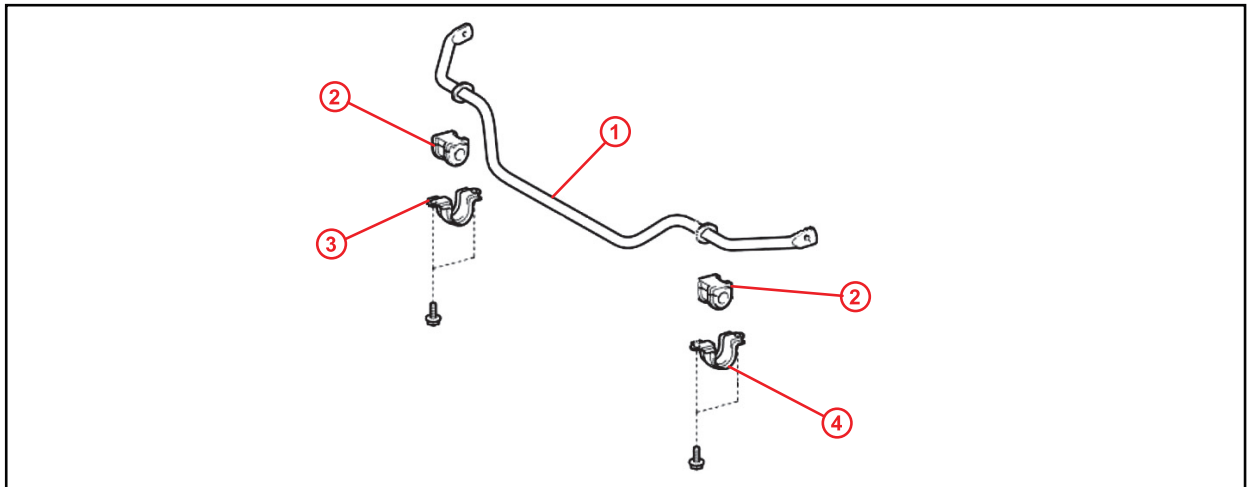

1	Front Stabilizer Bar
2	Front Stabilizer Bar Bushing

3	Front No. 2 Stabilizer Bracket RH
4	Front No. 2 Stabilizer Bracket LH

2. Confirm the noise has been eliminated.