


Last Modified: 7-13-2007		1.6 G
Service Category: Vehicle Exterior		Section: Door/Hatch
Model Year: 2008	Model: ES350	Doc ID: RM000000XNV00SX
Title: ENGINE HOOD / DOOR: LUGGAGE COMPARTMENT DOOR: ON-VEHICLE INSPECTION (2008 ES350)		

ON-VEHICLE INSPECTION

1. INSPECT LUGGAGE COMPARTMENT DOOR PANEL SUB-ASSEMBLY

(a) Check that the clearance measurements of areas A through E are within each standard range.

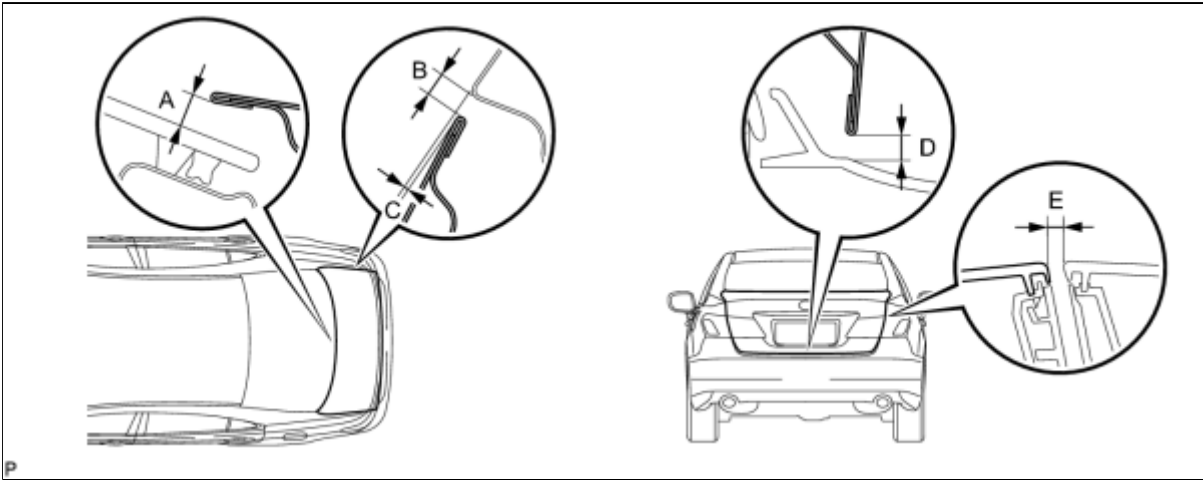

Standard clearance:

AREA	MEASUREMENT	AREA	MEASUREMENT
A	5.1 to 7.9 mm (0.201 to 0.311 in.)	D	4.3 to 7.3 mm (0.169 to 0.287 in.)
B	2.0 to 5.0 mm (0.079 to 0.197 in.)	E	2.5 to 5.5 mm (0.098 to 0.217 in.)
C	-1.3 to 1.7 mm (-0.051 to 0.067 in.)	-	-

